

TANDBERG SERVICE INFORMATION



Date : 8th May, 1975

T. R.

BULLETIN No. 3

TCD 310 — TCR 221

Pinch rollers released during playback and recording.

When the cassette deck has been in use for some time the pulse level from the reel motors may decrease. The voltage may drop so low that the motor power supply is switched off.

A more reliable operation is ensured by increasing the sensitivity of the motor signal amplifier while at the same time changing the filter characteristics.

The following components should be changed:

TCD 310	TCR 221	NEW VALUE
C505	C102	22 nF
C504	C101	10 μ F
C506	C103	47 μ F
R511	R112	12 k ohms
R120	R102	1.8 ohms

This modification has been introduced from serial No. 2958600 (approximately).